		INSTAL	LATION INSTRUC	TIONS		
BRACKET	OVAL SIDE BAR WIDESIDER 4"	WHEEL TO WHEEL WIDESIDER 4"	RUNNING BOARD WIDESIDER 5" & 6"		APPLICATION	MODEL
	394223	394319	39080	Dodge Ra	am 1500(USA) 2500(MEX) Quad Cab	09 - 15
ľ	394020	394320	39087	Dodge Ra	am 1500 (USA) 2500 (MEX) Crew Cab	09 - 15
392245	394005	-	-	Dodge	Ram 2500HD/3500HD Mega Cab	2010
6840995	64099 / 67099	-	680080		Dodge Ram 1500 Quad Cab	09 - 15
	64106 / 67106	_	680087			09 - 1
ŀ	64107 / 67107		-		e Ram 2500HD/3500HD Mega Cab	2010
Parts List:	04107 / 07107	-		Douge	Tools required not includin	
ITEM	QTY. CODE	DESCRIPT	ΓΙΟΝ	TORQUE	DESCRIPTION	y. QTY
1		ckets set (Front & Middle		-	13mm & 1/2" & 9/16" Hex Socket	1
2	6 372240BA	` T Plate	,	30 Lb.Ft	17mm Double hex socket (12	1
		durana kit in alu din m			point) or 15mm Wrench	4
3		dware kit including: 6" Square head bolt		11 Lb.Ft	Ratchet Extension ratchet	1 1
4		5" Flat washer		-	ILLUSTRATION 1	
5		5" Lock washer		-		
6		5" Hex nut		11 Lb.Ft	(1A)	h (1B
7	12 - 3/8	x 1" Hex. Head bolt		30 Lb.Ft		
8	18 - 3/8'	Flat washer		-	1 74	
9		Lock washer		-		/
10		x 1" Hex. Head bolt		30 Lb.Ft		
11 12		/l gasket		-	REAR DRIVER FRONT - DRIV	
	4 - INIO 394223(9-66) - 394020(9-6	x 25mm Hex head bolt	10/6-0) - 30/320/6-0) / 6/1	30 Lb.Ft		~
	C-PS-SB) - 64106 & 67106					
13		I side bar widesider 4"		-		Ø
nstructions					Approximated installation time:	30 min.
1. Before r	adinning the installation re	ad all instructions thorou	ianiv and verity that all har	dware is acc	ounted for. if there are any listed parts	
	fy your distributor immediat					missing
			ILLUSTRATION 2			missing
		ely.	ILLUSTRATION 2		FRONT	
		ely. Runn		6" /		
		ely. Runn	ILLUSTRATION 2	6" /		
		ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /		
		ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /		
		ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /		
		ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /		
		ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
		ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /		
		ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn C	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	
	• •	ely. Runn	ILLUSTRATION 2 ing board widesider 5" & ival Side Bar widesider 4	6" /	FRONT	

Illustration driver side.


Cleaning and care instructions:

Design: Quality: Protect the finish with a non-abrasive automotive wax, (e.g. Pure Carnauba) on a regular basis. The use of any soap, polish, or wax that contains an abrasive is detrimental to the finish, as the compounds scratch the finish and cause corrosion.

INSTALLATION INSTRUCTIONS

2. To install front, middle and rear mounting brackets locate in the rocker panel the holes covered in tape and remove the tape. Place one vinyl gasket to the bolt of the "T" plate then insert into the exposed hole. **SEE PICTURE 1.**

NOTE 1: It is important to place vinyl gaskets to the bolts to prevent the "T" plate from falling into the rocker panel.

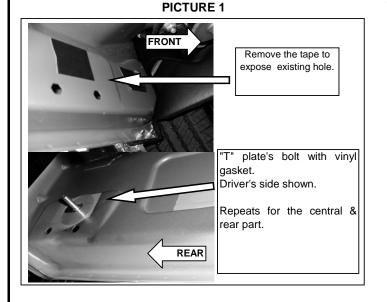


NOTE: If the vehicle model has two threaded holes in the lower part, attach with: 3/8" flat and lock washer, M8 x 25mm hex head bolt. By each threaded hole.

3. Place the front and middle bracket and attach to the bolt of the plate that it placed in the panel of the vehicle with: 3/8" flat and lock washers, 3/8" hex nut.

And to the nuts of the T plate with: $3/8 \times 1^{"}$ hex head bolt, $3/8^{"}$ flat and lock washer. **SEE ILLUSTRATION 3.** Leave loose.

ILLUSTRATION 3

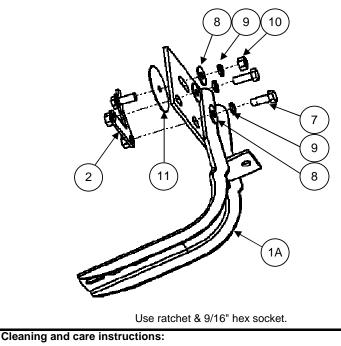


4. Place the rear bracket and attach of the same form that front and middle bracket. **SEE ILLUSTRATION 3.** Leave loose.

Repeat in opposite side.

5. If you acquired a Running board widesider 5" & 6", insert 5/16" square head bolt on rail, place on brackets and attach with: 5/16" Flat and lock washer, 5/16" hex hut. **SEE ILLUSTRATION 4.** Repeat for the opposite side. Leave loose.

ILLUSTRATION 4

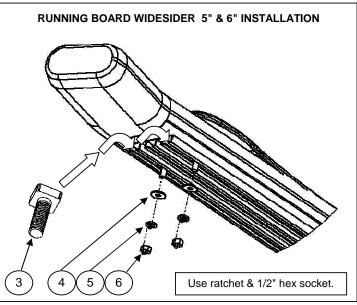


6. If you acquired a Oval side bar widesider 4", place on brackets and attach with: 5/16" square head bolt, 5/16" Flat and lock washer. **SEE ILLUSTRATION 5.** Repeat for the opposite side. Leave loose.

7. Align Running board widesider 5" & 6" or Oval side bar widesider 4" and then tighten all bolts.

8. Periodically check your product because it may need a re-tighten of bolts.

9. Fill the warranty card and place it inside your vehicle's glove box.

ILLUSTRATION 5

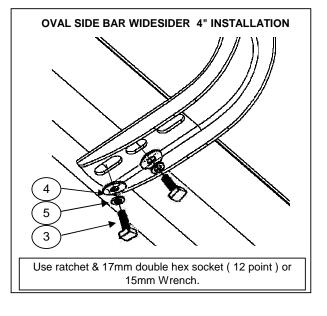

Quality:

Protect the finish with a non-abrasive automotive wax, (e.g. Pure Carnauba) on a regular basis. The use of any soap, polish, or wax that contains an abrasive is detrimental to the finish, as the compounds scratch the finish and cause corrosion.

Revised 30/11/2015

Design: